

## Highway Department



## Town of Chesterfield ADA Transition Plan

May 2019



Institute for Human Centered Design

200 Portland Street, Boston, MA 02114  
www.IHCDesign.org • info@IHCDesign.org  
617-695-1225 voice/tty

## Highway Department

Year Built: 1969 Year renovated: 2013

### Background

Chesterfield Highway Department is a one-story building located at 164 Main Road. The Highway Department holds town equipment for road maintenance. A sand pit open to the public is located to the west of the main building. The main entrance to the building is located on the southernmost side of the building. The parking lot is also located on the south side of the building.

### Key Accessibility Issues

#### Parking

Accessibility issues at the parking lot include lack of a van accessible space, access aisle and identification sign with the words "Van Accessible" with the International Symbol of Accessibility.

#### Other Accessibility Issues




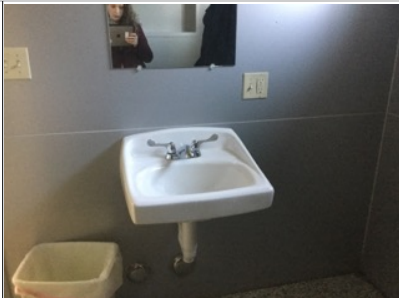
- Excessive threshold at the main entrance.
- Lack of compliant sign at the exit door.
- Mirror at the single-user toilet room mounted higher than the maximum allowed.

## Order of Magnitude Cost Estimates

- Miscellaneous Corrective Action (compliant threshold, exit sign, toilet room, van accessible parking space, etc.): \$719

**Total: \$719**

**Town of Chesterfield  
Highway Department**

ID	Location	Floor	Room	Element	Type	Photo	Issues	Current Measure	Recommendations	Quantity	Price	Cost Estimation
<b>Approach and Entrance</b>												
<b>Off-Street Parking Lot or Garage</b>												
1	Parking Lot	Ext.		Off-Street Parking Lot or Garage	Visitor		Total # of parking Total # of designated accessible parking spaces Vehicle space < 96" wide at car space Access aisle < 96" wide at van space Sign not provided Sign does not have the designation "Van Accessible" Sign bottom < 60" above finished grade	5 -	Provide a van accessible space that is at least 96" wide with a marked access aisle that is at least 96" wide. Provide a sign with the bottom of the sign 60" min. above the ground and the top 96" max. above the ground. Add the designation "Van Accessible" to the sign located at the van accessible space.	1	400	\$400
<b>Entrance</b>												
2	Main Entrance	Ext.		Entrance	Main Entrance		Threshold > 1/2" high	2"	Changes in level greater than 1/2" must be ramped. Consider providing a transition aluminum threshold ramp.	1	75	\$75
<b>Access to Goods and Services</b>												
<b>Signage</b>												
3	Main Entrance Interior	1		Signage	N/A		Not provided	-	Provide a sign with raised characters duplicated in braille. Locate sign alongside the door on the latch side.	1	116	\$116
<b>Toilet &amp; Bathing Rooms</b>												
<b>Lavatory</b>												
4	Single-User Toilet Room	1		Lavatory	N/A		Mirror above lavatory w/reflective surface > 40"	47"	Lower mirror so that the bottom surface is at 40" max. above finish floor.	1	128	\$128